



## A FDISD-5 Series



Certified according to ISO 9001:2008

The information provided herein is to the best of our knowledge true and accurate, it is provided for guidance only. All specifications are subject to change without prior notification.

Althen – Your expert partner in Sensors & Controls | althensensors.com

Althen stands for pioneering measurement and custom sensor solutions. In addition we offer services such as calibration, design & engineering, training and renting of measurement equipment.

Germany/Austria/Switzerland info@althen.de **Benelux** sales@althen.nl **France** info@althensensors.fr Sweden info@althensensors.se USA/Canada info@althensensors.com Other countries info@althensensors.com



#### Contents

1.	Over	view	3
2.	Safe	ty precautions	3
3.	Elect	tromagnetic compatibility	3
4.		r safety	
	4.1.	Class 3B sensors	4
5.	Gene	eral Information	5
6.	Mair	n Technical Data	5
7.	Exar	nple of item designation when ordering	6
8.	Syst	em Parts and Connections	7
9.	Dime	ensions and mounting	7
	9.1.	Settings	7
	9.2.	Measurement	9
10.	Conr	nection	10
11.	Worl	king with system and its software	10
	11.1.	Working with external (custom) DAQ	10
	11.2.	Working with sensor software	11
	11.3.	Configuration parameters	11
	11.4.	Working with sensor software	14
	11.5.	Controller reset to factory settings	14
	11.6.	Dynamic Link Library description	16
12.	Syst	em maintenance	17
13.	War	ranty	17
14.	Trou	bleshooting	18
	14.1.		
	14.2.	No speed measurement at object moving	18



### 1. Overview

Laser speed and length sensors are intended for industrial application in metallurgy, cable production, textile fabrics etc.

# Measuring principle – Laser Doppler interferometry (reflected type) for direct speed measurement and length calculation based on speed integration.

#### Industrial applications:

- Precision speed and length measurements of finite or infinite moving objects relative to fixed sensor.
- The sensor can be fixed on moving object ( crane, electric loader etc.) to measure its speed and displacement relative to ground

#### Main features:

- Precision measurements: up to 0,02 0,1 % RMS of speed and <0,05% absolute length (>1m).
- Reliable measurements on virtually all types of surfaces, including glass.
- Broad range of nominal distances: 10 100 cm and more.
- Original monolithic beam splitter forms stable interferometric pattern, and provides the bigger distance tolerance among such sensors up to  $\pm 25\%$  of nominal distance.
- Thermo compensated design provides temperature independent measurements, no thermo stabilization needed in broad temperature range\*.
- Low power consumption of sensor head (0,5 2 Wt depends of laser power needed) and controller module (1 Wt).

\*No temperature drift in +15...+50 °C range. At lower temperatures thermo stabilization of housing can be used.

## 2. Safety precautions

- Use supply voltage and interfaces indicated in the sensor specifications.
- In connection/disconnection of cables, the sensor power must be switched off..

## 3. Electromagnetic compatibility

The sensors have been developed for use in industry and meet the requirements of the following standards:

- EN 55022:2006 Information Technology Equipment. Radio disturbance characteristics. Limits and methods of measurement.
- EN 61000-6-2:2005 Electromagnetic compatibility (EMC). Generic standards. Immunity for industrial environments.
- EN 61326-1:2006 Electrical Equipment for Measurement, Control, and Laboratory Use. EMC Requirements. General requirements.




## 4. Laser safety

The sensors correspond to the following laser safety classes according to IEC 60825-1:2007

Model of the sensor	FDISD-5 Standard	FDISD-5 Mini
Wavelength, nm	635, 660, 808	635, 660
Output power. mW	5 - 120	3 - 4,8
Laser safety class	3B	3R

### 4.1 Class 3B sensors

In FDISD-5 Standard c.w. semiconductor visible range lasers 5 - 20 mW or IR up to 120 mW (for longest working distance) are used. They belong to 3B laser safety class. The following warning label is placed on the laser body (as an e[ample):

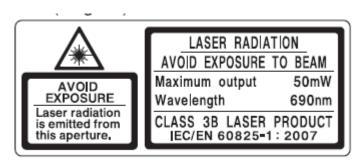


The following safety measures should be taken while operating the sensor:

- Do not target laser beam to humans;
- Avoid staring into the laser beam through optical instruments;
- Mount the sensor so that the laser beam is positioned above or below the eyes level
- Mount the sensor so that the laser beam does not fall onto a mirror surface;
- It is recommended to use protective goggles while operating the sensor;
- Avoid staring at the laser beam going out of the sensor and the beam reflected from a mirror surface;
- Do not disassemble the sensor;
- Use the protective screen mounted on the sensor for the bocking of the outgoing beam:

### 4.2. Class sensors 3R

In FDISD-5 Standard c.w. semiconductor visible range lasers <5 mW are used. They belong to 3B laser safety class. The following warning label is placed on the laser body (as an example):

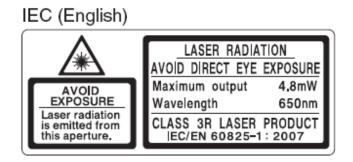



The following safety measures should be taken while operating the sensor:

- Do not target laser beam to humans;
- Avoid staring into the laser beam through optical instruments;
- Mount the sensor so that the laser beam is positioned above or below the eyes level;
- Mount the sensor so that the laser beam does not fall onto a mirror surface;
- Use protective goggles while operating the sensor;
- Avoid staring at the laser beam going out of the sensor and the beam reflected from a mirror surface;
- Do not disassemble the sensor;

## 5. General Information

Currently FDISD-5 family included 2 models with different versions with working range from 10 cm up to 100 cm and more. Custom-ordered configurations are possible with parameters different from those shown below.

Coming soon are 2-Dimentional sensors to measure, for instance, longitudinal speed of rotating tubes in tube-rolling mill, or transversal displacement of moving objects.

Although a special version of sensor for road application in automotive testing industry will be available soon.

Parameter	FDISD-5 standard	FDISD-5 mini	Notes
Speed range, m/s	0,02 - 20	0,005 - 5	Typical values. The less nominal working distance the less min and max speed range.
Speed accuracy*, % RMS	±0,07 ±0,02	±0,15 ±0,05	No signal averaging With averaging 0,2 - 0,3 s, at V > 1 m / s
Length accuracy*, % RMS	<±0,05	<±0,1	With pre-calibration at path lengths> 2 m.
Measuring frequency, Hz	16	- 54	
Nominal distance to the object (tolerance), cm	10, 20, 30, 50, 75, 100	10,15, 20	Could be noted at ordering
Distance tolerance	±20-25% of nominal		Depends on the surface ( on the edge of the range signal decreased)
Emitter type	Visible or IR c.v. Iaser, 5 – 120 mW	Visible c.v. laser, <5   mW	class 3B – 3R
Power supply, V	12 (8	- 14 )	Internal linear voltage regulators +5V in sensor and controller unit.
Power consumption, Wt: Sensor Controller unit	0,5 - 2	0,5 1	
Temperature working range, °C +15+50		+50	-10+50 – with active thermostabilization (option): -50+80 °C with protect air cooling housing (option).
Sensor weight, g	320	70	
Sensor size, mm	85x79x46	58x43x30	Without connector , blend and fixing holes (see picture below)
Cable length from sensor to controller unit, v			1,8 or 3 Standard cable RS-232 or VGA with DB9 connectors are used. To extend a length it is possible to connect cables sequential.

## 6. Main Technical Data



IP67

<b>Controller unit:</b> Weight, g Size, mm Analog out	350 120x100x35 Speed, 150 mV/(m/s) 3V max.			
Frequency out	Length, 2000 pulses/m (=speed 2000 Hz/(m/s), meander 0 – 3 V, TTL compatible, up to 200 KHz.	Typical values, user adjustable (see software description below). ADC and frequency resolution – 12 bit		
Digital out Physical data latency at measurement freq, ms 54 Hz 16 Hz	Ethernet (UDP protocol) 9 31	Others on request Stable, =½ of measuring time, with- out averaging.		
Base Software	<ul> <li>Program to read data via Ethernet, visualization and saving data;</li> <li>Program for sensor diagnostics</li> <li>Read data example (LabView 8.2.1 and higher);</li> <li>Dynamic library (DLL) to read data via Ethernet</li> <li>Sensor parameters configuration via any Internet browser</li> </ul>	See below for details. Custom software by request are possible.		

\*Precalibration needed to reject the geometric errors of sensor mounting.

Due to our continuous efforts to improve sensors, we reserve the right to change specification without prior notice.

### 7. Example of item designation when ordering

FDISD - 5 - St - 30cm - ET+232+CAN - AN(U) - PL - 3m - H - P

Symbol	Description
St	St – Standard
	Lt – Mini
30cm	Nominal distance to the object
ET+232+CAN	Digital interfaces:
	ET - Ethernet – base, other - options:
	232 or 485– RS232 (485),
	CAN — to avoid any discrepancies the data format of client DAQ needed
AN(U)	Analog out, voltage (U) — base -  or current (I)
PL	Pulse out – base
3m	Cable length from sensor to controller unit
Н	Sensor with in-built heater (option)
Р	Sensor with protect air cooling housing (option)



## 8. System Parts and Connections

System parts and connections are shown on fig.1 below.

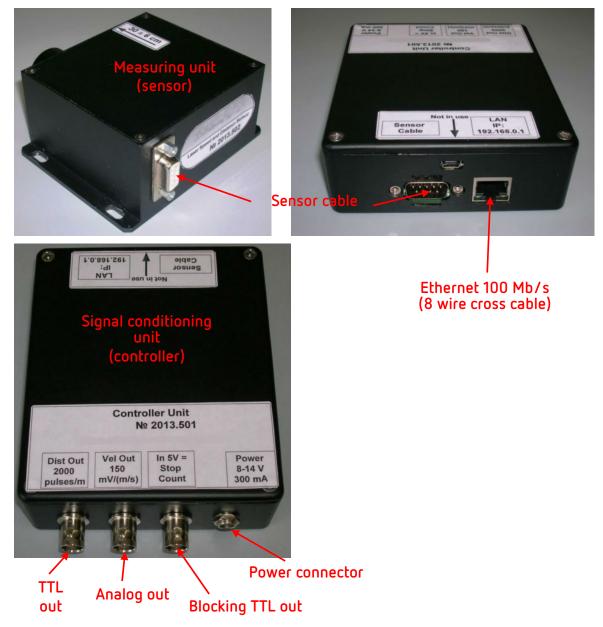


Fig. 1. Sensor parts and connectors.


At +5V on "Stop Count" on no pulses on TTL out. It is used when there are long stops in object (cable, for instance) moving to avoid false reading in length.

## 9. Dimensions and mounting

### 9.1. Overall demands for sensor mounting

Mounting holes sizes and sensor axes relative to moving object are shown on fig.2.



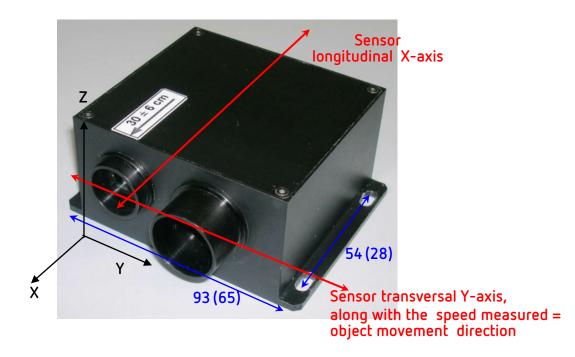


#### Fig. 2. Sensor position relative to moving object along Y-axis.

Nominal distance to the object could be measured from front plane of the sensor, as indicated. Mountig holes positions in brackets – for Mini version.

Sensor X-axis must be perpendicular and Y-axis – parallel to object moving direction. In ZY plane (perpendicular to drawing plane) sensor Z-axis can be tilted from vertical position (for instance, to avoid the light direct reflection to sensor receiver area from glossy surface). Note: inaccuracy (non-perpendicular/parallel with angle  $\alpha$ ) in sensor X and Y axis relative to object moving direction will lead to decreasing the measurements as  $sin(\alpha)$ . For instance, at  $\alpha=4^{\circ}$  measured speed will less then actual in 0,24%. That is why, the pre-calibration needed to reject the align errors to achieve the maximum accuracy.



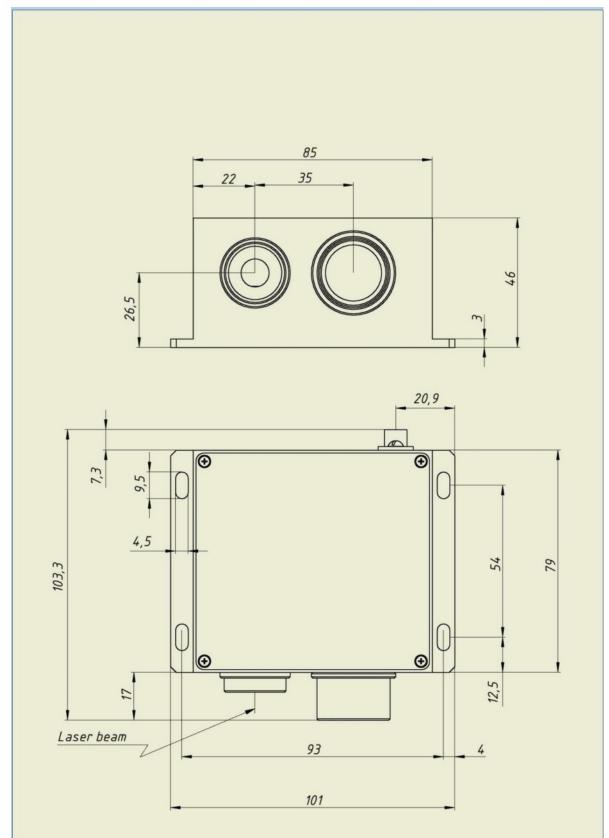

### 9.2. Overall and mounting sensor dimensions

Fig.3. Overall and mounting dimentions of FDISD-5 Standard.



## 10. Connection

### 10.1. Designation of connector contacts.

Connector	Туре	Assignment, Comments				
Sensor: Cable Controller unit:	DB9F	1 – GND of power supply $^{1}$ 2 – GND of signals $^{1}$				
Cable	DB9M	3 – Signal «+» <sup>2</sup> 4 – Signal«-» <sup>2</sup> 5 – «+» of power supply				
Ethernet	RJ-45	To connect controller unit with other PC via Ethernet 100 Mb (8 wires cross cable)				
Pulse output	BNC	$0 - 3V, 8 \text{ mA max}^{3}$				
Analog output	BNC	0,015 – 2,8 V, Rout = 15 KOm <sup>4</sup>				
Stop pulse output	BNC	Input, 5V stops pulses (output stay in «1»)				
Supply	DS-016N socket	«+» on central				
	Option: PY04-4Z plug	4-pins 1,2 – «+» power, 3,4 – GND.				

1 – Grounds joined in controller unit. Signal ground connected to the controller unit housing.

2 – Differential pair, joined to single-ended in controller unit.

3 – Direct digital output. Max. Freq is 200 KHz.

4 – Direct not buffered DAC output. Load resistance must be > 1,5 MOm.

### 10.2. Cables

All cables used are standard (on the shell).

Cable between sensor and controller unit: RS232 or VGA 9 pin 9 wires: 1-1; 2-2; ...9-9. VGA cable has shield connected to the connectors houses (recommended at high EMI environment). Cables can be connected in series up to 10 - 15 m. Ethernet cable - 8 wires 4 twisted pair cross cable, up to 30 m. Signals outputs (BNC) - coaxial up to 15 m.

## 11. Working with system and its software

### 11.1. Working with external (custom) DAQ

- Fix sensor properly relative to the object.
- Connect sensor and controller unit by cable, switch the power ON. Warming time (without thermostabilization) is 1 -2 min.
- Connect pulse output with the counter input. At 2000 pulcas/m 1 count = 0,5 mm.

At first mounting, to reject a geometric errors, sensor calibration needed.
 Move the object from stand still to stand stil on the known distance (>2 m or more) for 3 - 5 times. If needed correct the calibration multiplier in DAQ or controller software (see below).



Pulse output can be used for speed measurement too. Frequency 2000 Hz corresponds 1 m/s. But to measure frequency correctly measurement frequency could be at least no less then sensor update frequency.

To measure the speed analog output is more convenient. Calibration multiplier that was found by length measurement could be applied here too. Warning: DAC output is not buffered to keep the metrological characteristic, so load resistance must be high, at least >1,5 MOm. Additionally, there is a DC offset – ab. 15 mV that could be taken into account.

### 11.2. Working with sensor software

The sensor can be connected to the PC via network. Sensor IP address is 192.168.0.1 by default. To establish the direct cable (use cross cable configuration) connection, PC must have static address 192.168.0.XXX with 255.255.255.0 mask.

#### 11.3. Configuration parameters

Open any Internet browser (Internet Explorer, Opera ...), enter controller IP as an address. Page with sensor configuration parameters appears (see next page):



TCP/IP config IP ADDR 192.168.0.1			Controller mode config OS_FACTOR 6			
CMD PORT 3001					OP_MODE_SEND_SIG	
onin-ronti pool					OP_MODE_SEND_FFT	
					OP_MODE_SEND_SPD	
			PROC_SHIFT	204	18	
Algorithm paramet	ers		Output signal o	conf	līg	
SNR_LIM1	10.000		VEL_MIN		0.0500000	
SNR_LIM2	10.000		VEL_MAX		100.000000	
USE_ACC I			OUT_FRQ_M	N	20	
SN_DIV	1.000000		OUT_FRQ_M	AX	50000	
MED_FLT_PTS	2				,	
	2		Noise reductio			
AVG FLT PTS [			NOISE_HARM	1	p	
	109000				b	
vel_mlt_kmh			NOISE_WIDT	Η	þ	
VEL_MLT_KMH	5.000000		NOISE_WIDT	Η	μ	
VEL_MLT_KMH			NOISE_WIDT	Η	μ	

#### Fig. 4. Page with sensor configuration parameters.

What is opened is a content of flash memory of the controller. It is factory (not recommended to change) and user's parameters. It is recommended to save factory configuration, at least as a picture (ALT+PrtSc).

Parameters details:

"TCP/IP Config":



- IP\_ADDR Contriller's address. Non recommended to change without necessity. If changed do not foget to enter new address in browther after controller restart.
- DATA\_PORT Port on PC where data sended. The same must be used as a parameter to read data by DLL (see below).
- CMD\_PORT Controller port where writes the parameters. Do not change!

#### "Algorithm parameters":

 SNR\_LIM1 and SNR\_LIM2 – Signal to Noise Ratio Limit – to distinguish between standstill and moving object. If real less – speed regarded as = 0. Typical values at stand still are 4 – 6. At moving object S/N 1 (and S/N 2 at velocities > 20% of Vmax) > 100 typically. See real S/N at stand still in the software (see below) and set it 1,5 – 2,5 times more to guarantee V=0 at stand still. But in some cases (vibrating object or by-side moving objects in the sensor beam pass, including possible reflections) – some velocity measurement at standstill can occur.

In some range it can be overcome by S/N increasing. Current S/N can be observed in the program supplied (see below). At very high noises at standstill or at long stops – use function "Stop Count" (when frequency output used) and unblock it just before the start moving.

- USE\_ACC Not used in industrial version, do not change!
- S/N\_DIV For future use, do not change.
- MED\_FLT\_PTS Median filter order (points of measurements taking into account. Min. value = 0 (no filter).
- AVG\_FLT\_PTS Order of data averaging filter. Min. value = 1 (no filter)
- VEL\_MLT\_KMH Velocity calibration multiplier. Act to length calculation too.
- VEL\_RSP Define the maximum velocity changing at abrupt real velocity changing. The more the value, the faster sensor can react. For automotive application value 10 corresponded ab. 1 g acceleration at 34 Hz measurement.
- AC\_COEFF Calibration multiplier for internal accelerometer (when USE\_ACC selected). Do not change!
- LF\_SUPPR for factory use only, do not change!

#### «Controller mode config »:

- OS\_FACTOR Act on ADC sampling time, Do not change!
- OP\_MODE Set the controller mode. Selected modes activates ones:

OP\_MODE\_PROCESS – process the data and send the result to frequency and analog output. OP\_MODE\_SEND\_SIG, OP\_MODE\_SEND\_FFT, OP\_MODE\_SEND\_SPD – Send the data via Ethernet. **Only one or no one must be selected** (No one – data not sent to Net, just to Freq and An – max measuring freq possible (up to 100 Hz)).

Use OP\_MODE\_SEND\_SPD to work with a visualization program supplied (see below). Use OP\_MODE\_SEND\_FFT to work with a diagnostic program supplied (see below)



 PROC\_SHIFT — Allow to change measurement frequency (sliding average mode) with step of 512 points. But maximum result frequency must not exceed 80 Hz with sending data via Net and 100 Hz without Net.

#### «Output signal config»:

- VEL\_MIN and VEL\_MAX Limits max and min velocities measured in Km/h in terms of analog and frequency outputs (at VEL\_MIN analog output is 0,015 V, at VEL\_MAX analog output is 3 V). Example: to set 40 mV/m/s : 3V/0,04V/m/s = 75 m/s = 270 Km/h = VEL\_MAX
- OUT\_ERQ\_MIN and OUT\_FRQ\_MAX Define min and max frequency output at VEL\_MIN and VEL\_MAX. To set 400 pulses/m (=400Hz/m/s) : 400Hz/m/s\*75m/s = 30000 Hz = OUT\_FRQ\_MAX.

#### «Noise reduction»:

- NOISE\_HARM and NOISE\_WIDTH – Allows programmatically suppress narrow-band electromagnetic noise. See 10.4. below for details.

After changing and writing parameters, controller must be restarted. Press button "Restart" (it takes 1 sec only), then you have to reload the page, because during reset the connection with controller was lost.

### 11.1. Controller reset to factory settings

In case of controller firmware damage (loosing power during writing new data, writing wrong parametes etc.) it can work incorrect or loose Ethernet connections. In this case initial factory settings can be restored as following:

- Switch OFF Controller Power.
- Unplug the sensor cable from controller and insert DB9 with pins 7 and 8 connected or just connect pins 7 and 8 by wire.
- Switch ON Controller Power for 3 5 s. Factory settings is restored.
- Remove DB9 or wire, plug the sensor cable.
- Do not forget to write user parameters if they were differ from factory ones.

#### 11.2. Working with sensor software

For viewing and saving the sensor data a special program supplied (LabView based). To run LV execution files an environment like Run Time Engine must be installed first. Just run setup in ISD\_Installer directory. After installation, any LV .exe files can be run on this PC.



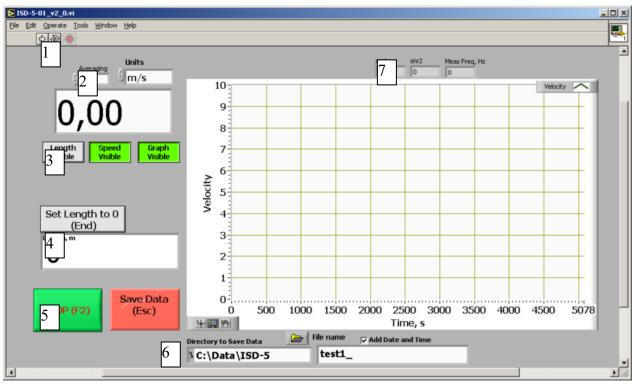


Fig.5. FDISD-3\_En\_v2\_0.exe -

Program to work with sensor data sended from controller to PC via Ethernet connection.

Here:

- 1 Run program button 🕑 . When it runs the indicator 🔘 (abort button) becomes red.
- 2 Current speed indicator in selectable units and averaging (acts to indicator and Speed Chart only, not to saving data).
- 3 Visibility ON/OFF of indicators. All ON load PC significantly, especially at high measurement frequency
- 4 Length indicator with button to set it to 0. Act on saving length data too. Note: controller send cumulative length from its power ON, so use the button "set Length to 0" before start measurement (brake test for instance).
- 5 Program Stop button. Use it to stop program to correct closing the PC ports and data file (see 6 below).
- 6 Save Data button. When it pressed, the data writes to file its directory and name are editable. Note, that the directory must exist (created in advance), file with the name will be created automatically. After test is over, use Stop program button to correct closing the file. Data saves as text file (ASCII) in 3 columns: No of measurement; Speed [Km/h]; Length [m] starting from 0 if Set to 0 was pressed before test starts.
- 7 Current S/N and measuring frequency indicators. Normally, at standstill S/N is ab. 4 7.
   If it much more there are some extra noises or moving objects in the sensor view area (see 10.3 above). Try to increase S/N in "Algorithm Parameters" or use diagnostic program (see fig.6. below).



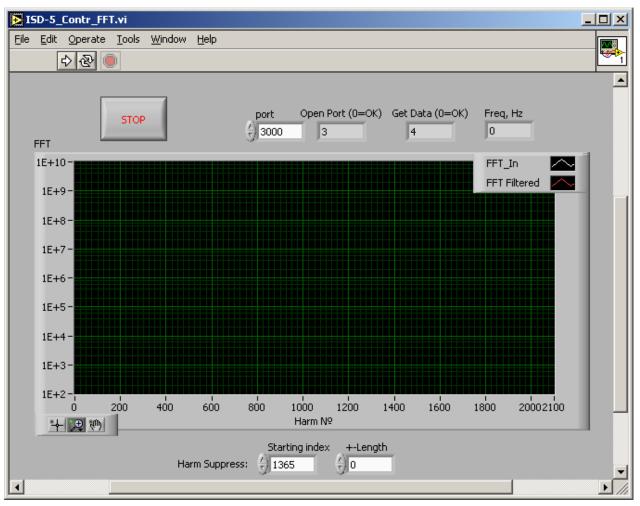



Fig.6. FDISD-5\_Contr\_FFT.exe - Sensor diagnostic program.

This program mostly designated for industrial sensor application. To work with it, select OP\_MODE\_SEND\_FFT in "Controller mode config". Here the FFT spectrum of sensor signal presented. You can see the presence of signal from moving object, adjust the sensor position to get a maximum signal (measuring of cable length, for instance). Additionally, the possible electromagnetic or optical noises (in hard industrial environment) can be seen. If it present, try to change the sensor position, grounding etc. If it unremovable, it is possible to suppress it with "Noise reduction" function.

### 11.3. Dynamic Link Library description

User can read the sensor data in third party software environment like C++, LabView and others. For this, liblv\_dll.dll module can be used. Data format is in lv\_dll.h file. To read the data via Ethernet only 3 function needed. Below are examples for LabView environment.

#### OpenLib :

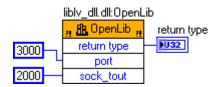



Opens and configure PC ports to work with net UDP protocol.

Input parameters:

- **port** No of port to receive the data must be the same as in controller DATA\_PORT (see. 10.3).
- **sock\_tout** Timeout for data waiting in ms.

Output: **return type**, 0 = , or see lv\_dll.h for list of errors.

GetSpeed:

liblv_dll.dll:GetSpe	ed 📓
n 🖪 GetSpeed n	~
return type	
frame_num	
speed	<b>-</b>
length	<b></b>
snr1	<b></b>
snr2	<b>—</b>
acc_x	<b></b>
acc_y	<b>_</b>
acc z	<b>_</b>

Reads the data continuously.

- return type, 0 = OK

- frame\_num - No of measurement;

- **speed** current speed [Km/h];
- length length [m] from controller power ON;
- **snr1, snr2** Current S/N;
- acc\_x, acc\_y, acc\_z Current accelerations [m/c<sup>2</sup>]

CloseLib:

liblv\_dll.dll:CloseLib



Close the port and releases the PC resources. It must be executed before program stops.

## 12. System maintenance

The sensor head and processor unit has no service points. Maintenance limited to keeping clean the sensor windows. Note: Do not use solvents for cleaning!

## 13. Warranty

Warranty period is 18 months after selling.



## 14. Troubleshooting

### 14.1. Some constant speed measured and standstill

There is strong electromagnetic noise on the controller ADC input. As a rule, it induced on cable signal wires from power wires, especially if pulse DC-DC converter used or some pulse power consumers (like DAQ system) feeded from the same source.

Use separate power source if possible. Use diagnostic program to see the noise and to suppress it.

### 14.2. No speed measurement at object moving

- Cable or electronic damage or wrong parameters in the sensor setup. Use the diagnostic program to see the signals.
- No Ethernet connection (programs does not running). Reset the controller to factory settings (see 9.3. above).

Sensor repairing must carried out by manufacturer only.

The information provided herein is to the best of our knowledge true and accurate, it is provided for guidance only. All specifications are subject to change without prior notification.

Althen – Your expert partner in Sensors & Controls | althensensors.com

Althen stands for pioneering measurement and custom sensor solutions. In addition we offer services such as calibration, design & engineering, training and renting of measurement equipment.

Germany/Austria/Switzerland

**Benelux** sales@althen.nl **France** info@althensensors.fr Sweden info@althensensors.se USA/Canada info@althensensors.com Other countries info@althensensors.com